


Source: Leece-Neville Heavy Duty Systems Division - Arcade, NY USA  
 Date: July 7, 2017  
 Bulletin No: TSB-1026  
 Models: 8SC2023Z  
 Subject: Wiring Diagram

**Lamp Circuit Notice!**

Circuit is optional and is not needed for normal alternator operation.

Circuit is not a D+ (Diode Trio) terminal.  
 If a fault occurs in the alternator or not rotating, a path to ground is established.  
 If alternator is operating properly the path to ground is removed.  
 This circuit does not provide a voltage source while the alternator is operating.

Regulator will be damaged if connected directly to battery.

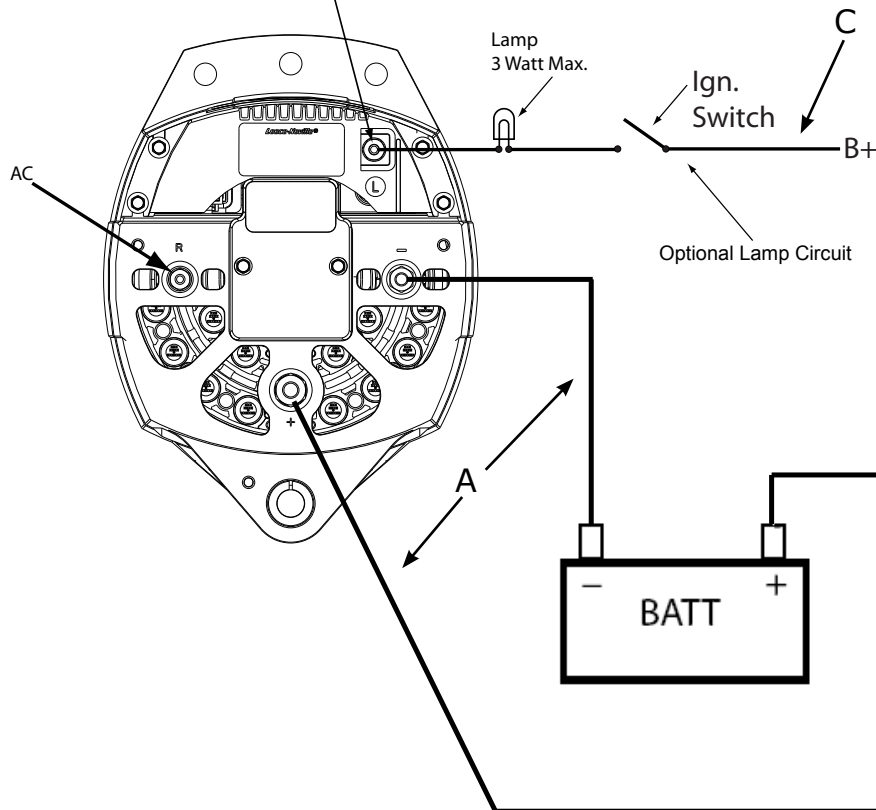

This Technical Service Bulletin is intended to be used with TSB-1001.

Important: The information contained in this bulletin is intended for use by trained, professional technicians who have the proper tools, equipment, and training to perform the required maintenance described above. This information is NOT intended for 'do-it-yourselfers'; and you should not assume that this information applies to your equipment. If you have any questions regarding this information please visit our website at [www.prestolite.com](http://www.prestolite.com), or contact our technical service department at: